## SUMMARY - ORDER OF RECOMMENDED WORKS - St Peter & St Paul Mottistone

OSMINARY ORDER OF RECOMMENDED WORKS OF CLOT & ST Paul Motifications					
P1 Items. Immediate – Within 12 months					
Refer to item:					
2.1, 8.2 SW & North Nave Roof	Replace broken tiles				
2.1 & 25.4 Roof tiling & copings	Remove moss/weed growth & repoint				
3.1, 4.1, 5.2, Tower & nave walling	Remove weeds & repoint.				
8.5 North exit door	Overhaul & decorate door				
10.4 West windows to Cheke chapel North side 20.4 (internally)	Overhaul & paint metal opening lights & operating catches to windows.				
13.2 Fascia to Chancel	Restain fascia				
17.4, 18.1, 18.4, 19.1, 21.1, 21.5 Floorboards & pews generally	Arrange inspection & treatment for active woodworm				
19.4 South windows to Chancel	Repoint around stone surrounds where necessary.				
20.3 Cheke Chapel roof	Investigate damage to purlin, trims & timber boarding to SW corner of roof (& valley externally) Make good to roof internally				
21.4 West window to North Aisle (internally)	Finish new lintol decorations to west window				
21.4 West door to North Aisle	Overhaul & redecorate door & ironmongery				
4.2, 24.1, 24.2, 24.3, 24.4 Power, Lighting, Heating & Fire Equipment	Arrange for complete Electrical inspection & testing of all equipment including checking of incoming mains connection. Service Fire Extinguishers.				
25.4 North Lych gate structure	Clean moss & Ivy of roof, re-point cracked stone work to gate jambs and to adjacent boundary wall.				
25.5 East Entrance Gate	Provide & build in new ss gate pins and rehang gate				
26.5 South Churchyard Walls	Re-build sections of walls adjacent entrance to churchyard where risk of collapse				
P2 Items. Works to be carried out – Within 2 – 3 years					
Refer to item:					

7.1 East face of tower

13.3 South face of Chancel

13.5 Door to South elevation of Chancel

25.3 East Entrance Gateway & Arch.

Replace displaced stone at high level.

Repair eroded areas of random rubble stone walling.

Repair /replace damaged (inner) jamb stones

Rebuild former arch & gateway re-using existing stone where possible. Provide new ironmongery & Re-hang gate.

P3 Items.	Works to	be	carried	out -
Within 3 -	5 years			

Refer to item:

6.1 Northwest corner of tower Replace eroded quoin blocks

8.4 North side of Nave Replace eroded stone jamb & 2 mullions

## P4 Items. Works to be carried out – Within 10years

Refer to item:

11.1 East window to Cheke chapel & sanctuary Fully investigate condition of dressed stone transom & tracery stonework of feature windows & restore as

necessary.

<u>Maintenance Items – Items referenced M in</u> report.

Refer to item:

1.1, 8.2, 10.1, 15.1 Roof tiling Clean off moss/weeds & algae build up.

8.5 Stonework generally Carefully clean off moss build up.

8.6, 13.5 Timber doors & fittings Redecorate doors periodically, inspect metalwork for

corrosion, rub down & redecorate as necessary.

9.3,10.2, 11.3 Rainwater hoppers, pipes & gullies | Fully inspect & clean as necessary.

10.1 Valley between Nave & Cheke chapel Inspect from ladder access arrange for cleaning as

necessary

10.3 Dressed stone window surrounds Repoint

13.5 External Door to chancel Overhaul hinges/fittings & redecorate door

18.2 Nave ceiling boards Inspect loose boards & secure if necessary.

25.2 Stone boundary walls Remove all excessive vegetation & growth from

boundary walls & carry out re-pointing generally

Regular Maintenance Items

Rainwater gutters, hoppers & gullies Regularly inspect & clean as necessary.

Floor tiling & boarding Inspect regularly & make good any damaged loose

tiles or boards.

Metal windows internally Inspect for corrosion Rub down & redecorate as

necessary.

Air Bricks / louvres to walls Keep all vents air bricks etc. clear of leaves &

planting.

planting.

Ivy growth & planting adjacent boundary walls, Entrance gates and Lych gate structure.

Maintain planting & growth adjacent walls to prevent damage particularly Ivy growth to cracks & pointing

to copings.

Lead valley gutters & flashings. Periodically check from ladders condition of leadwork to valleys & concealed abutments. Items for further investigation and/or to be kept under regular observation - Items referenced O in report. Refer to item: 7.1 Stained stone parapet to East face of tower. Obtain advice from stonemason/specialist with regard to dis-colouring stain to stonework & possible removal if necessary. 8.3 North walls to Nave Investigate algae & possible cleaning methods 17.2 Internal stone columns, arches & walls with Obtain specialist advice regarding the 'powdering 'powdering chalky' surfaces. chalky' stonework and advice with regard to type & cost of remedial works required. 18.3 High level window to nave adjacent Provide suitable access & inspect high level window Chancel arch & surround (point if necessary). Misc. Items for periodic checking or consideration. Refer to item: Arrange for complete Electrical inspection & testing of all equipment & fittings including switchgear & Electrical incoming mains. Regular inspections should be carried out by certified approved contractors. Fire extinguishers, emergency lighting etc. should be Fire Equipment regularly checked & serviced by suitably qualified contractors. Inspection and testing of lightning conductor to the <u>Lightning conductor</u> building.

## ITEMS TO CONSIDER FOR FUTURE IMPROVEMENTS

- Restore glazed leaded light windows
- Replace pvc gutters.

Health & Safety

- Improve security to doors and windows
- Restore badly eroded stonework

**Rainey Petrie Architecture Ltd** 

East Quay, Kite Hill, Wootton Bridge Isle of Wight PO33 4LA

February 2015

Difficult access to tower, roof, high level windows

to suitably responsible persons only.

and ceilings, with ladder / steps, minimal handrailing & no balustrading to top – access should be limited